






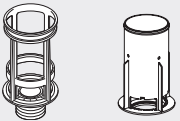
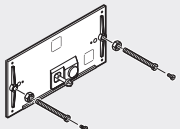


1.3 UP-Spülkasten

1.3.1 UP-Spülkasten Betätigung von vorne (1964-1977)

							
		PA I/1115	PA I/IX 1884/I PA I/IX 1885/I		PA I/1637 PA I/IX 1886/I PA I/IX 1887/I	PA I/IX 1886/I PA I/IX 1887/I	PA I/IX 2331/I PA I/IX 2760/I
		15.000 (1964-1967)	10.500 (1970-1973)	16.000 (1965-1967)	10.600/620 (1967-1973)	10.600 (1974-1977)	10.800 / 400 (1975-1986)
	Service Umbau-Set (Wassersparset Spül-Stopp)	215.420.00.1	215.422.00.1	215.421.00.1	215.423.00.1	215.423.00.1	240.026.00.1
	Betätigungsplatte 200F	115.222.xx.1	115.222.xx.1	115.222.xx.1	115.222.xx.1	115.222.xx.1	115.222.xx.1
	Stopfen für Heberglocke	240.031.00.1	240.031.00.1	240.031.00.1	240.031.00.1	240.031.00.1	240.031.00.1
	Bügelset für Heberglocke	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1
	Heberglocken- dichtung	891.015.00.1 (Ø 63x23)	891.015.00.1 (Ø 63x23)	891.015.00.1 (Ø 63x23)	891.015.00.1 (Ø 63x23)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)
	Füllventil Unifill	240.705.00.1 & Set 240.047.00.1	240.705.00.1	240.705.00.1 & Set 240.047.00.1	240.705.00.1 & Set 240.712.00.1	240.705.00.1	240.705.00.1
	Dichtungsset zu Füllventil Unifill	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1

	Bassin (Austausch)	–	240.187.00.1	–	240.187.00.1	ACHTUNG! Bassin nicht austauschbar - Sonderlösung über Geberit	
	Bassindichtung	–	894.082.00.1	–	894.082.00.1	–	–
	Niederhalter	241.170.00.1	241.170.00.1	–	241.170.00.1	241.170.00.1	241.170.00.1
	Eckventil	–	216.599.00.1	–	216.599.00.1	216.599.00.1	216.599.00.1
	Lippendichtung zu Steckverbindung ø 45	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1
	Schutzplatte mit Bügel Bet. von vorne) ohne Gewindestangen	–	–	–	–	240.026.00.1	240.026.00.1
	Gewindestangen	–	–	–	–	216.024.00.1	216.024.00.1
	Feder	813.514.00.1	813.514.00.1	813.514.00.1	813.514.00.1	813.514.00.1	813.514.00.1