






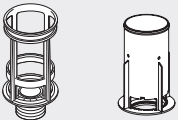
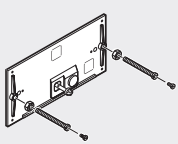


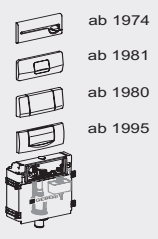
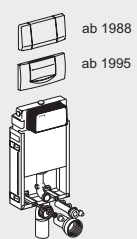



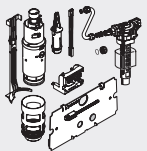
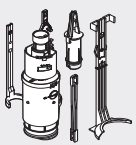

1.3 UP-Spülkasten

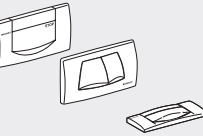
1.3.1 UP-Spülkasten Betätigung von vorne (1964-1977)

							
		PA I/1115	PA I/IX 1884/I PA I/IX 1885/I		PA I/1637 PA I/IX 1886/I PA I/IX 1887/I	PA I/IX 1886/I PA I/IX 1887/I	PA I/IX 2331/I PA I/IX 2760/I
		15.000 (1964-1967)	10.500 (1970-1973)	16.000 (1965-1967)	10.600/620 (1967-1973)	10.600 (1974-1977)	10.800 / 400 (1975-1986)
	Service Umbau-Set (Wassersparset Spül-Stopp)	215.420.00.1	215.422.00.1	215.421.00.1	215.423.00.1	215.423.00.1	240.026.00.1
	Betätigungsplatte 200F	115.222.xx.1	115.222.xx.1	115.222.xx.1	115.222.xx.1	115.222.xx.1	115.222.xx.1
	Stopfen für Heberglocke	240.031.00.1	240.031.00.1	240.031.00.1	240.031.00.1	240.031.00.1	240.031.00.1
	Bügelset für Heberglocke	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1
	Heberglocken- dichtung	891.015.00.1 (Ø 63x23)	891.015.00.1 (Ø 63x23)	891.015.00.1 (Ø 63x23)	891.015.00.1 (Ø 63x23)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)
	Füllventil Unifill	240.705.00.1 & Set 240.047.00.1	240.705.00.1	240.705.00.1 & Set 240.047.00.1	240.705.00.1 & Set 240.712.00.1	240.705.00.1	240.705.00.1
	Dichtungsset zu Füllventil Unifill	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1

	Bassin (Austausch)	–	240.187.00.1	–	240.187.00.1	ACHTUNG! Bassin nicht austauschbar - Sonderlösung über Geberit	
	Bassindichtung	–	894.082.00.1	–	894.082.00.1	–	–
	Niederhalter	241.170.00.1	241.170.00.1	–	241.170.00.1	241.170.00.1	241.170.00.1
	Eckventil	–	216.599.00.1	–	216.599.00.1	216.599.00.1	216.599.00.1
	Lippendichtung zu Steckverbindung ø 45	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1
	Schutzplatte mit Bügel Bet. von vorne) ohne Gewindestangen	–	–	–	–	240.026.00.1	240.026.00.1
	Gewindestangen	–	–	–	–	216.024.00.1	216.024.00.1
	Feder	813.514.00.1	813.514.00.1	813.514.00.1	813.514.00.1	813.514.00.1	813.514.00.1

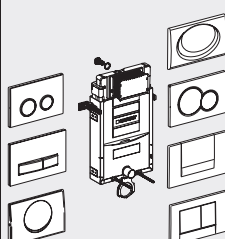
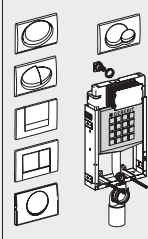
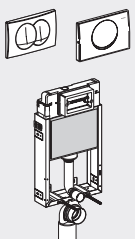
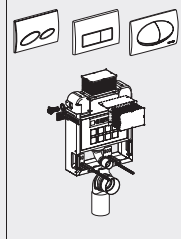




1.3.2 UP-Spülkasten Betätigung von vorne / von oben (ab 1978)

						
		PA I/IX 2761/I	PA I/IX 2761/I	PA I/IX 2761/I	PA I/IX 3403/I PA I/IX 3495/I PA I/IX 3535	PA I/IX 3403/I PA I/IX 3495/I PA I/IX 3535
		10.800 (Schutzplatte transparent, Befestigungsschrauben aus Messing) (1978-1987)	110.855/857 110.900 (Schutzplatte weiß) (1988-1997)	110.857/900 110.133 (1998-2004)	110.962/963 (1986-1994)	110.970/975 (ab 1995)
	Service Umbau-Set (Wassersparset)	240.835.00.1 & Betätigungsplatte Twinline	240.515.00.2 & Betätigungsplatte Twinline	–	–	–
	Ersatzheberglocke (Spülgarnitur)	240.114.00.1	240.114.00.1	240.501.00.1	240.114.00.1	240.113.00.1
	Bügelset für Heberglocke	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1
	Heberglockendichtung	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)
	Füllventil Impuls380	240.705.00.1	240.705.00.1	240.705.00.1	240.705.00.1 + 240.321.00.1 ¹	240.705.00.1
	Dichtungsset zu Füllventil Unifill	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1

	1. Verbindungsschlauch 2. Dichtungsset	–	240.069.00.1 (1.) 240.922.00.1 (2.)	240.069.00.1 (1.) 240.922.00.1 (2.)	240.321.00.1 (1.)	240.321.00.1 (1.)
	O-Ring zu Steckverbindung ø 45	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1	362.771.00.1
	Eckventil	216.599.00.1	216.599.00.1	216.599.00.1	216.599.00.1	216.599.00.1
	Bassin (Austausch)	240.195.00.1	240.195.00.1	240.500.00.1	240.195.00.1	240.195.00.1
	Bassindichtung	240.282.00.1	240.282.00.1	240.282.00.1	240.282.00.1	240.282.00.1
	Niederhalter	241.170.00.1	241.170.00.1	240.506.00.1	240.072.00.1	240.072.00.1
	Schutzplatte	240.026.00.1	240.073.00.1	240.512.00.1	–	–
	Lagerbock	–	240.510.00.1	240.510.00.1	–	–
	Betätigungsplatten	115.222.xx.1 115.888.xx.1	115.222.xx.1 115.888.xx.1	115.222.xx.1 115.888.xx.1	115.333.xx.1	115.333.xx.1
	Umrüstsets auf neue Betäti- gungsplatte	–	–	–	240.175.00.1 240.178.00.1	240.175.00.1 240.178.00.1
	Verlängerungsset (bei erhöhter Vor-/Aufmaue- rung)	–	240.058.00.1	240.058.00.1	240.087.00.1 240.178.00.1	240.180.00.1
	1. Drückerstange 2. Distanzbolzen	216.024.00.1 (messing)	240.074.00.1 (1.) 240.067.00.1 (2.)	240.074.00.1 (1.) 240.067.00.1 (2.)	–	240.323.00.1 (1.)
	Bauschutz	240.233.00.1	240.233.00.1	240.233.00.1	–	–
	Staeinsatz	217.807.00.1	217.807.00.1	217.807.00.1 240.476.00.1 (ab 1997)	240.476.00.1	240.476.00.1

1. Beim Austausch Kompakt gegen Unifill wird der Verbindungsschlauch 240.321.00.1 zusätzlich benötigt.

1.3.3 UP-Spülkasten Betätigung von vorne / von oben (ab 2002)

		 UP320 (ab 04/2008)	 UP300 (2002-03/2008)	 UP100 (ab 2005)	 UP200 (ab 2006)	 UP Artline (1999-2005)
	Ersatzheberglocke mit Niederhalter (Spülgarnitur)	240.622.00.1	240.622.00.1	240.622.00.1	240.638.00.1	240.638.00.1
	Bügelset für Heberglocke	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1	241.167.00.1
	Heberglockendichtung	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)	816.418.00.1 (Ø 63x32)
	Bassin (Austausch)	241.859.00.1	241.859.00.1	241.859.00.1	241.859.00.1	241.859.00.1
	- Dichtung zum Bassin (Austausch)	241.868.00.1	241.868.00.1	241.868.00.1	241.868.00.1	241.868.00.1
	Bassinichtung	241.868.00.1	240.282.00.1	240.282.00.1	240.282.00.1	240.282.00.1
	Impuls 380 Füllventil	240.705.00.1	240.705.00.1 und 240.921.00.1	240.705.00.1	240.705.00.1	240.705.00.1
	Halteklammer zu Impuls 380 Füllventil	240.923.00.1	240.923.00.1	–	–	–
	Dichtungsset zu Impuls 380 Füllventil	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1	240.771.00.1